

MX3200・5200

MX3200 Series 安全縫いミシン
Safety stitch machines

MX5200 Series オーバーロックミシン
Overedgers

Parts Checker



PEGASUS®

Exploded view diagram of a mechanical assembly, likely a pump or motor housing. The diagram shows the main housing (9A30670) and the internal assembly (2106790). The internal assembly includes a motor (MX) and a pump (PERASUS). Various components are labeled with part numbers:

- 9A30710
- 9A30670
- 2106790
- 2403250
- 2106790
- 2101820
- 2700470
- 2402990
- 0045110
- 6A003200000
- 2403361

Exploded view diagram of the MX5200 Series 2700120, MX3200 Series 2700130, and MX3216-02.03.A04 9C800300000. The diagram shows the main chassis, various panels, and internal components with their respective part numbers. A note indicates that some accessories are packed in the accessory box.

Part numbers and components shown:

- 9A30020
- 6R000100000
- 2401100
- 007024A0
- 6F00010PD00
- 6G00520PB00
- 0071760
- 9A30690
- 1L300200000
- 6G00260PD00
- 0070440
- 007019A0
- 6G005300000
- 007017A0
- 2100440
- 007017A0
- 2096800
- 007021A0
- 007022A0
- 0045350
- 0045740
- 270018A0
- 6G005600000
- 007018A0
- 007021A0
- 0070090
- 9A31261
- 2400430
- 0045430
- 2403010
- 007021A0
- 6C00100PD00
- 2700140

Note: 付属品に梱入
Packed in accessory

Legend:

- MX5200 Series 2700120
- MX3200 Series 2700130
- MX3216-02.03.A04 9C800300000
- MX3216-02.03 9C800100000
- MX3216-A04 9C800200000
- MX5204-02.32R2 MX5205-12 9C800400000
- MX5214-M03, M53 9C800500000

0070840
6F00020000

0070200
2096870

007018A0
1B001100000
6K003709100

2103070
0070660
2700341
0048210
007023A0

●MX3200
6G005400000
●MX5200
6G005500000

0070620
2028750

2700151
0070770

2700450
2403050
0071800
2700490
2403050
0073730

0045430
2700420

2103070
0070660
2403430
007018A0
2700430
2700440
2403050

●MX5205-12を除く
Out side MX5205-12
6E000060PB00
(広巾) (Wide)

0070080
2700480
2012520
007025A0

●MX3216-A04を除く
Out side MX3216-A04
スタンダードリフト・ハイリフト
Standard lift, High lift
4P0002A0000

0070440
007020A0
2096090

●MX3200

007019A0
2096080

●MX5200

●MX5200
0073740

●MX3200
2705100

2095810

0045140

0045720

209591-910

0071510

2705020
0070110

2705030

2705020
0070110

2100570

2100560

2403060

2115260

2129870

2403350

0045560

2705260

0045230

2042930

270504-PD0







0045410



2705051

007020A0


2403400

2115280

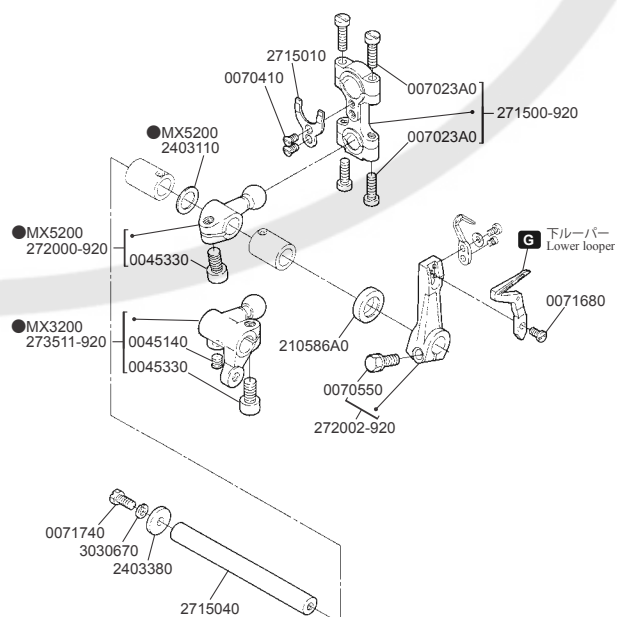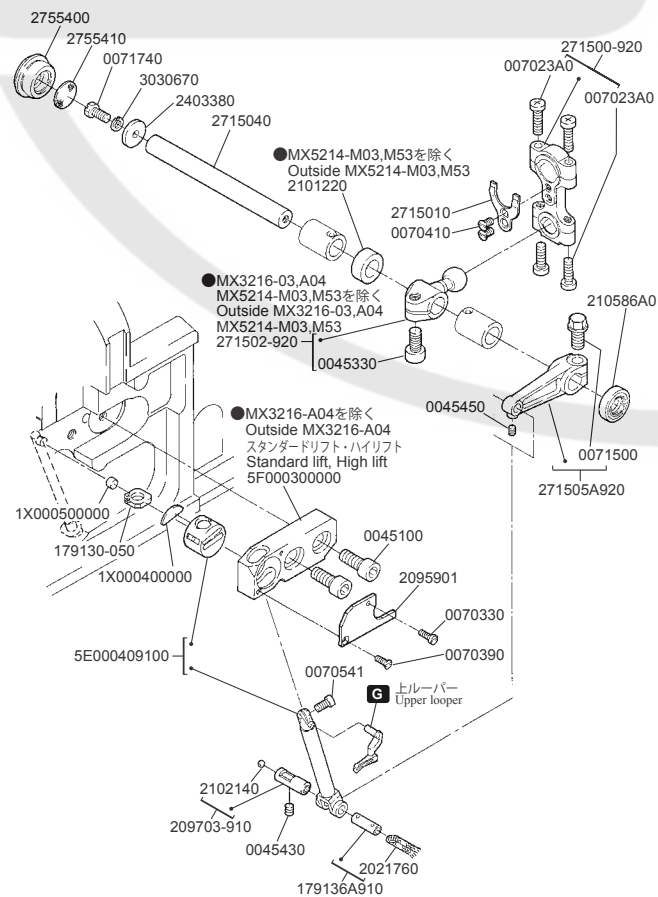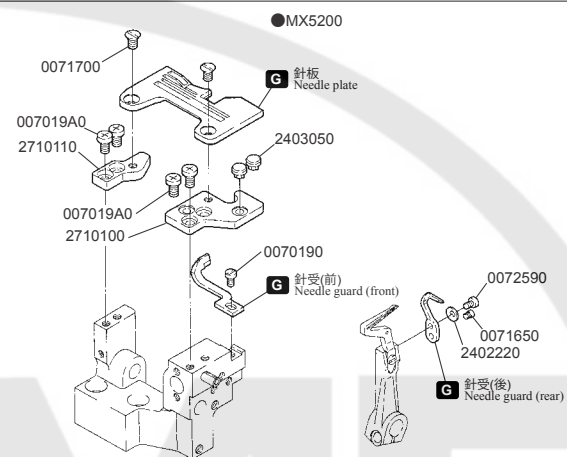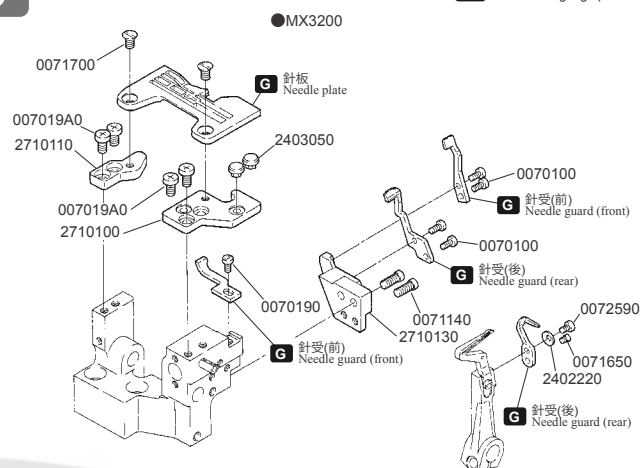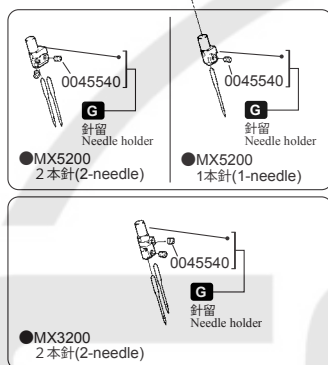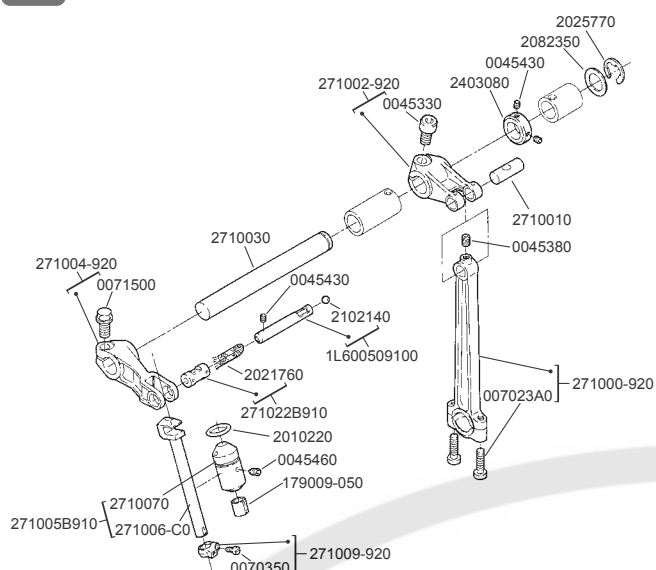


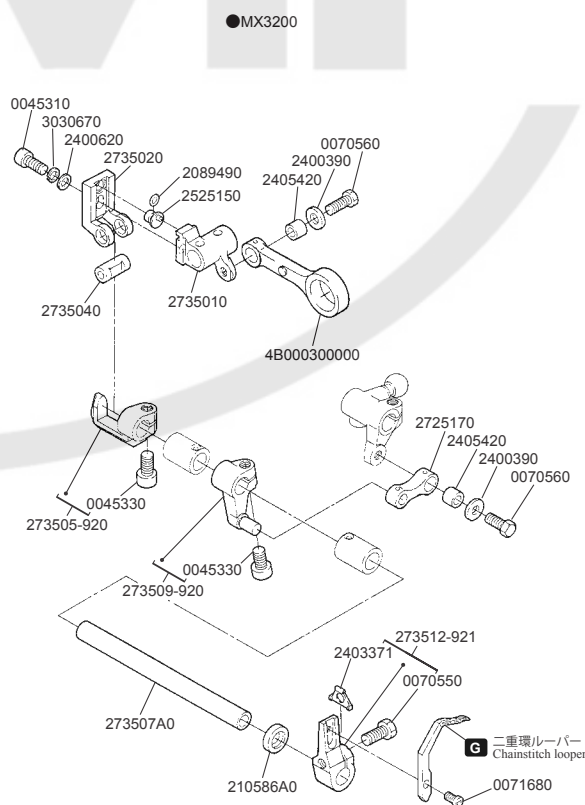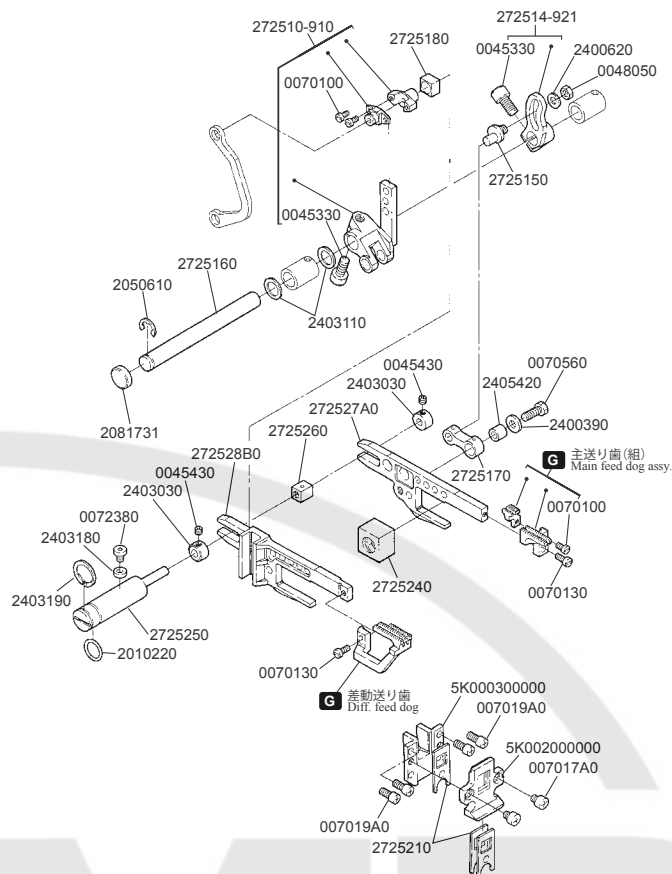

13

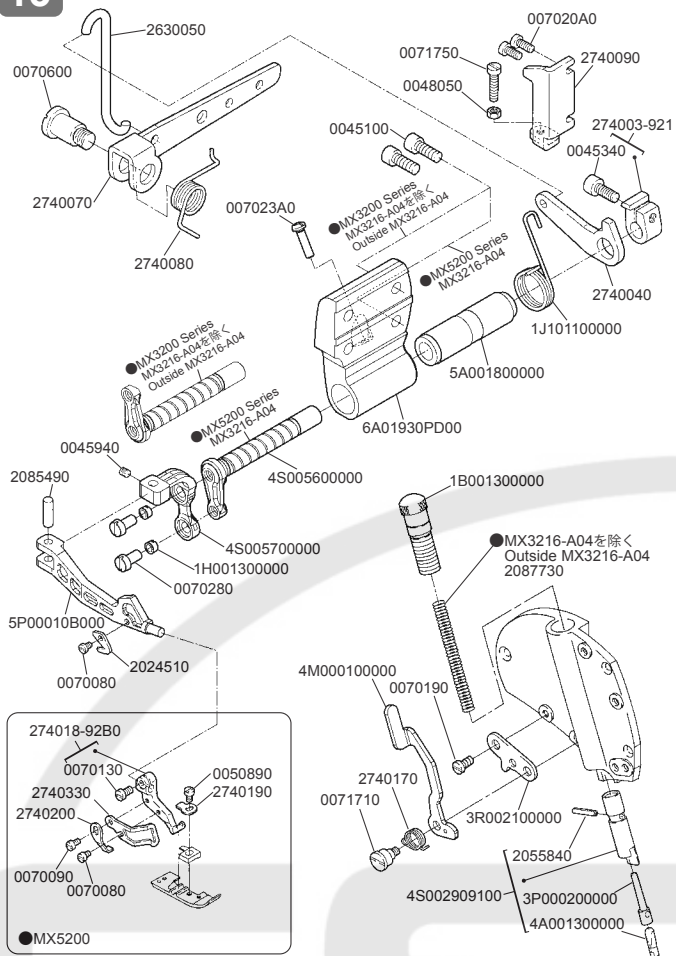


14

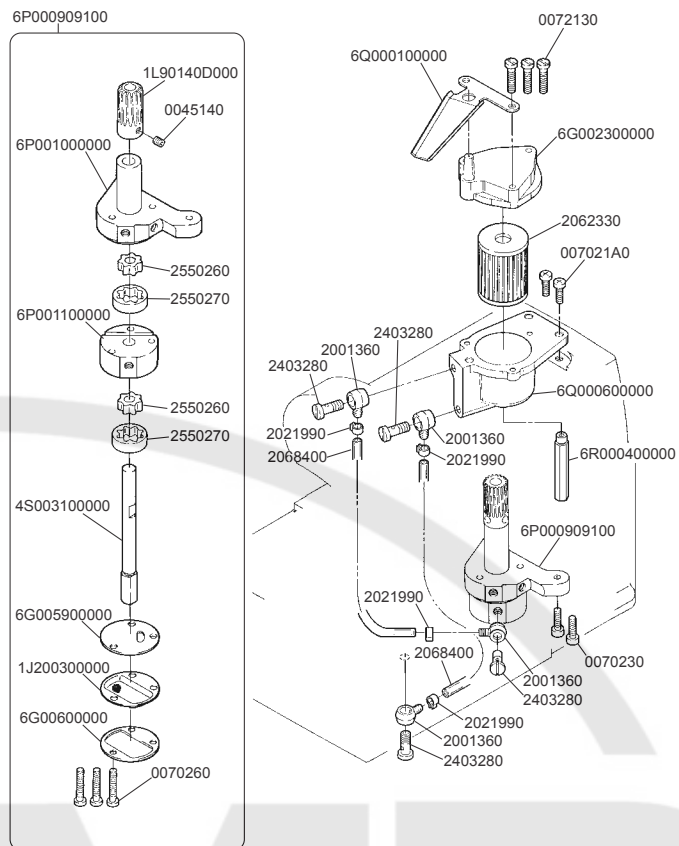


15

★印はインチネジです。
★=inch size

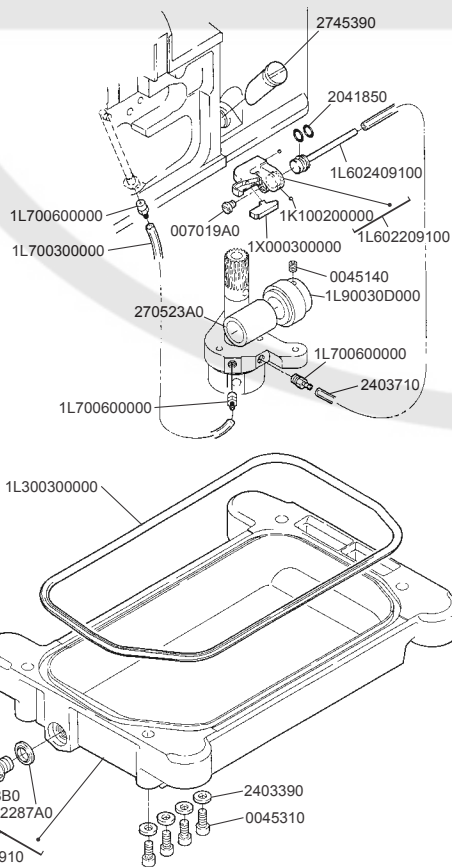


16


★印はインチネジです。
★=inch size

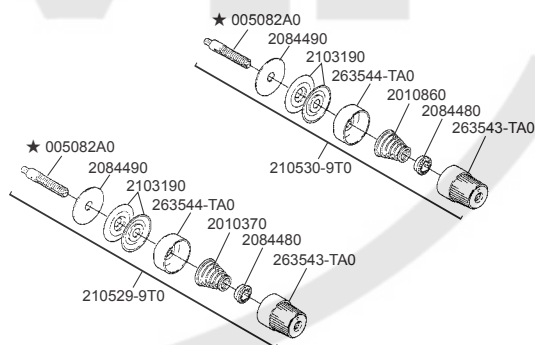


●MX5204-02,32R2
MX5205-12

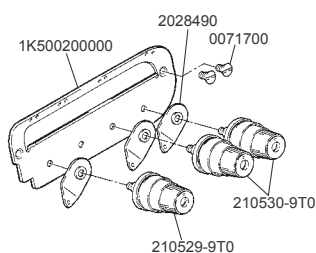



●MX3216-02,03
MX5214-M03,M53
MX3216-A04を除く
Outside MX3216-A04

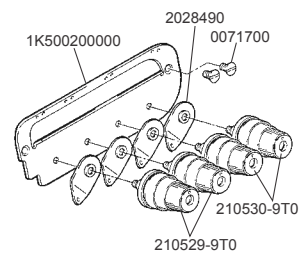


●MX3200

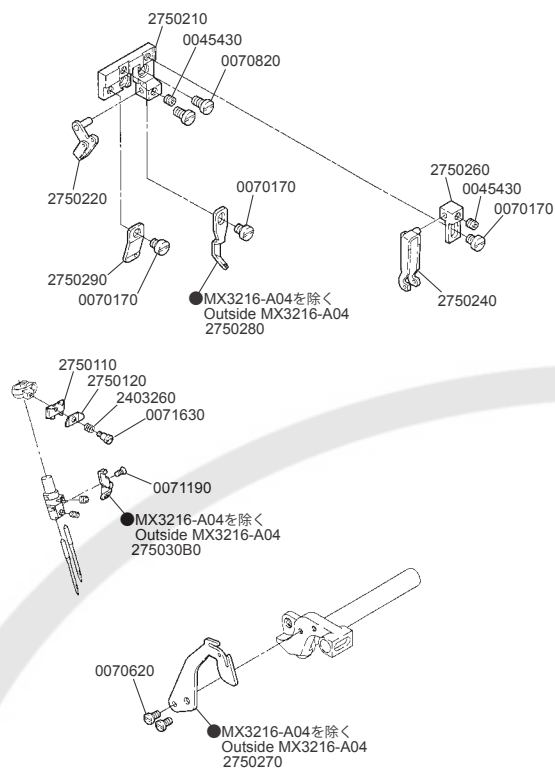


●MX5200

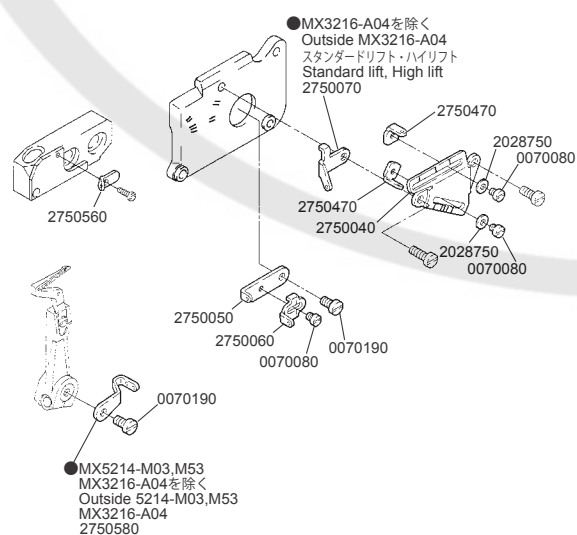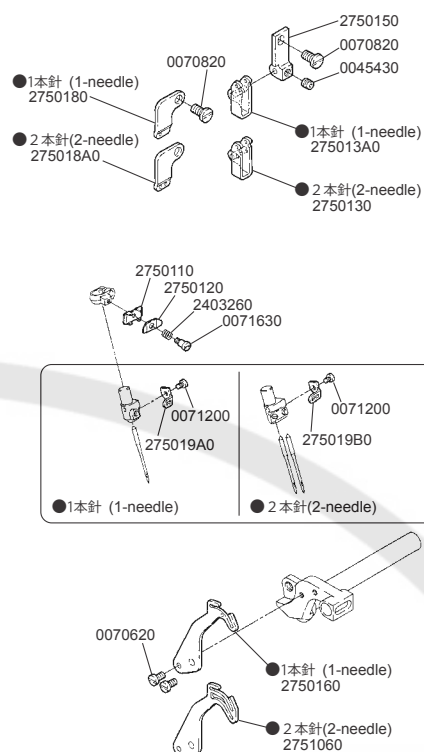




●MX3200

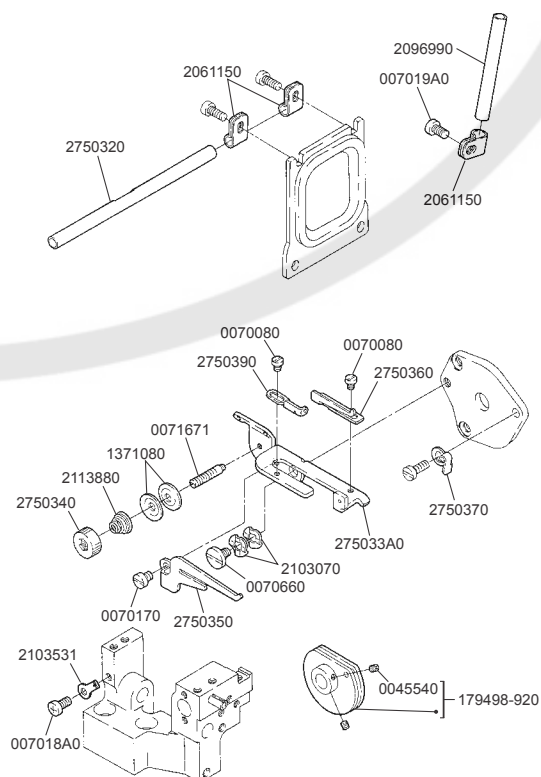

●MX3216-A04

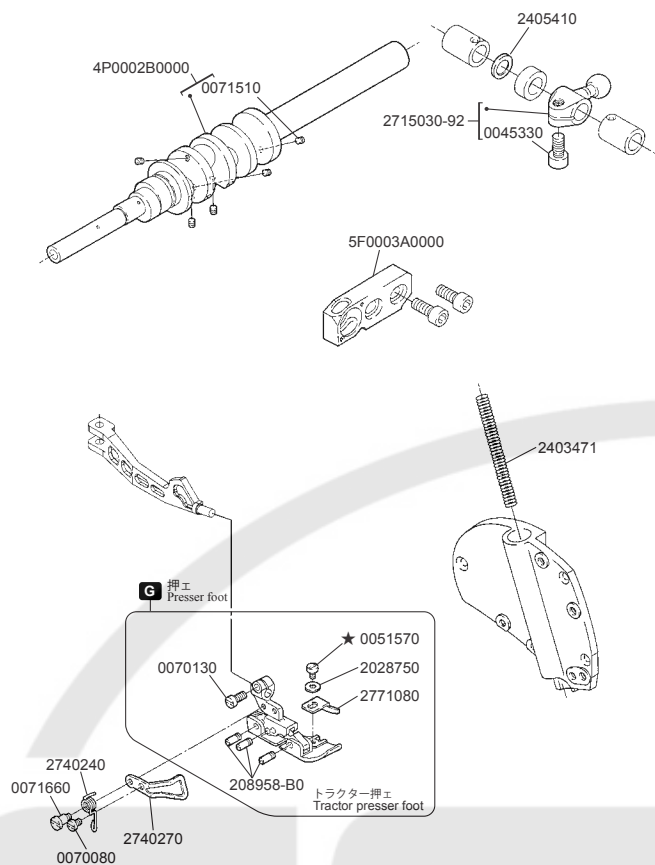

●MX3216-A04

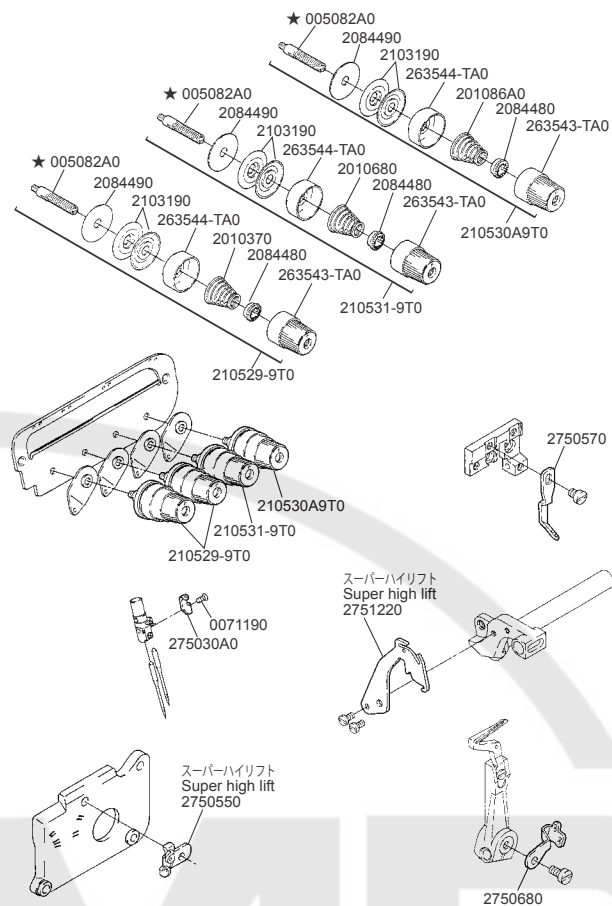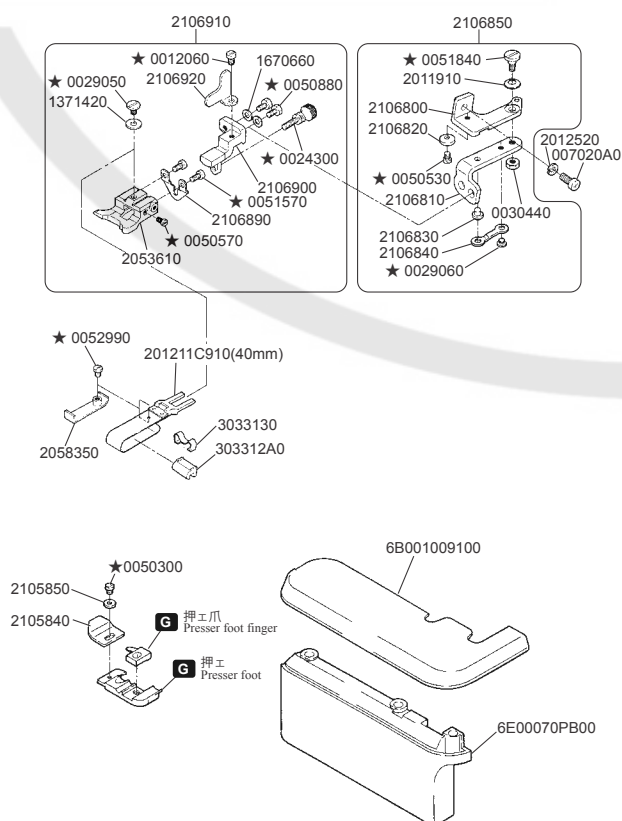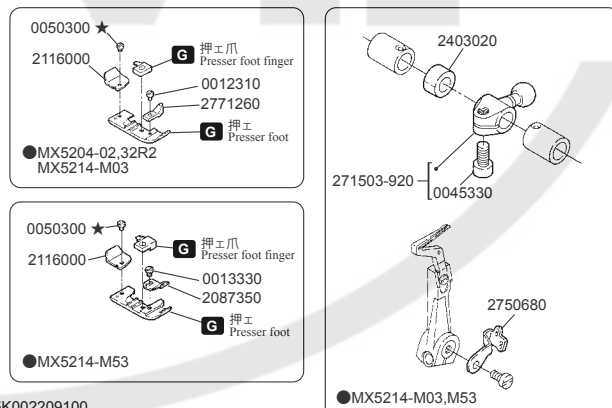●MX5205-12
裾引き(Blindhemming)●MX5204-02.32R2
MX5214-M03,M53

●MX5214-M53
附属品に梱入
Packed in accessory

MX3200 ゲージパーツ表

MX3200 GAUGE PARTS LIST

ミシン形式	ゲージ		針板	主送り歯(組)	主送り歯本体	補助送り歯	差動送り歯	押エ(組)	上ルーパー	下ルーパー	二重環ルーパー	上メス
	NG	SW	NEEDLE PLATE	MAIN FEED DOG ASSM.	MAIN FEED DOG	AUX. FEED DOG	DIFF. FEED DOG	PRESSER FOOT ASSM.	UPPER LOOPER	LOWER LOOPER	CHAINSTITCH LOOPER	UPPER KNIFE
MACHINE TYPE /SPEC												
MX3216-02/223	3	4	277513R400	277323-160	(277324-160)	(277318-130)	277325-160	2771180	2770100	2770150	2770180	201121A0
MX3216-03/333	3	4	277517R400	277327-160	(277328-160)	(277318-130)	277330-160	2771180	2770100	2770150	2770180	201121A0
	5	5	277516R500				277329-160	2771190				
MX3216-A04/435	5	6	277524T602	277337-252	(277427-250)	(277428-200)	277339 -251	2771220	2770110	2770150	277018-C0	201121A0

ミシン形式	ゲージ		下メス	オーバー針受け		二重環針受		針留	針
	NG	SW	LOWER KNIFE	前	後	前	後	NEEDLE HOLDER	NEEDLE
MACHINE TYPE /SPEC				OVERLOCK NEEDLE GUARD FRONT	OVERLOCK NEEDLE GUARD REAR	CHAINSTITCH NEEDLE GUARD FRONT	CHAINSTITCH NEEDLE GUARD REAR		
MX3216-02/223	3	4	2022950	2770070	2770040	2770080	2770060	277027-921	DC×27 #11
MX3216-03/333	3	4	2022950	2770070	2770040	2770080	2770060	277027-921	DC×27 #14
	5	5						277028-920	DC×27 #14
MX3216-A04/435	5	6	2022950	2770070	2770040	2770080	2770060	277029-920	DC×27 #21

MX5200 ゲージパーツ表

MX5200 GAUGE PARTS LIST

ミシン形式	ゲージ		針板	主送り歯(組)	主送り歯本体	補助送り歯	差動送り歯	押エ	押エ爪	上ルーパー	下ルーパー	上メス
	NG	SW	NEEDLE PLATE	MAIN FEED DOG ASSM.	MAIN FEED DOG	AUX. FEED DOG	DIFF. FEED DOG	PRESSER FOOT ASSM.	PRESSER FOOT FINGER	UPPER LOOPER	LOWER LOOPER	UPPER KNIFE
MACHINE TYPE /SPEC												
MX5204-02/233	—	4	277504R400	277303-16F0	(277304-16F0)	(277318-130)	277305-16F0	201230C0	2103710	2770100	2770150	201121A0
MX5204-32R2/223L	—	1.5	277502P150	277315-16F0	(277301-16F0)	(277319-130)	277302-16F0	2027990	2055250	2770100	2770150	201121A0
MX5205-12/223	—	4	277500P400	277300-16F0	(277301-16F0)	(277318-130)	277302-16F0	201152E0	2771030	2770100	2770150	201121A0
MX5214-M03/333	2	4	277505R400	277303-16F0	(277304-16F0)	(277318-130)	277305-16F0	201230C0	2103740	277010A0	2770340	201121A0
MX5214-M53/333	2	4	277505R400	277303-16F0	(277304-16F0)	(277318-130)	277305-16F0	2771120	2086510	277010A0	2770340	201121A0

ミシン形式	ゲージ		下メス	針受け		針留	針
	NG	SW	LOWER KNIFE	前	後	NEEDLE HOLDER	NEEDLE
MACHINE TYPE /SPEC				NEEDLE GUARD FRONT	NEEDLE GUARD REAR		
MX5204-02/233	—	4	2022950	2770050	2770040	179630-920	DC×27 #9
MX5204-32R2/223L	—	1.5	2022950	2770050	2770040	179630-920	DC×27 #11
MX5205-12/223	—	4	2022950	2770050	2770040	179630-920	DC×27 #9
MX5214-M03/333	2	4	2022950	2770050	2770040	277022-920	DC×27 #9
MX5214-M53/333	2	4	2022950	2770050	2770040	277022-920	DC×27 #9

ペガサスミシン製造株式会社

本社 〒 553-0002 大阪市福島区鷺洲 5-7-2 TEL (06)6458-4739
FAX (06)6454-8785

PEGASUS SEWING MACHINE MFG. CO., LTD.

5-7-2, Sagisu, Fukushima-ku, Osaka 553-0002, Japan. Phone : (06)6458-4739
Telefax : (06)6454-8785

Cat. No. 9B900200000  April 2003

©2003 PEGASUS SEWING MACHINE MFG. CO., LTD.

このパーツチェッカーに記載されている内容は、改良のため予告なく変更することがあります。

The description in this PARTS CHECKER is subject to change without prior notice for improvement.